CHEVROLET—CENTRAL OFFICE

DIVISION OF GENERAL MOTORS CORPORATION DETROIT 2, MICHIGAN



TECHNICAL SERVICE BULLETIN

Service and Mechanical Department



SUBJECT:

Corvette Ventilator Window Lock - Tail

Pipe Extension

BULLETIN NO.: TSB #325

SECTION: I

TO: All Chevrolet Service Personnel

November 24, 1954

SIDE DOOR VENTILATOR LOCK

A Side Door Ventilator Lock to hold the Ventilator in the closed position has been released for production and service.

PARTS DATA

PART NUMBER

Side Door Ventilator Slide Lock Unit (2 required).

3717205

INSTALLATION

Slide Clip along upper corner of ventilator window frame.

Close ventilator window and slide clip as far as possible into locked position.

With clip in locked position drill #47 (.0785) diameter hole through ventilator window frame at forward end of slot.

Carefully press pin in hole till end is flush with side of clip.

TAIL PIPE EXTENSION

A longer tail pipe extension with a baffle to deflect the exhaust gases downward to eliminate staining of the paint has been released.

PARTS DATA

PART NUMBER

Tail Pipe Extension

3711147

Entered Production 5-18-54 - Serioal No. E545 002628.

POLICY

The above items may be installed to handle customer complaints.

